MECHANICAL CONNECTORS

'USMB-C' & 'USMB5-C' Copper 'Y' Connector





Principle Application:

'Y' Branch jointing of circular copper or aluminium stranded conductors.

Range:

Connector Reference	Stranded Core Size				
	2 x Main		1 x Tap		
	Min	Max	Min	Max	
USMB/FPL-C	#3	350 kcmil	#3	350 kcmil	
	(27mm²)	(177mm²)	(27mm²)	(177mm²)	
USMB/FPL-2-C	350 kcmil	750 kcmil	#3	350 kcmil	
	(177mm²)	(380mm²)	(27mm²)	(177mm²)	
USMB/FPL-4-C	2/0	500 kcmil	2/0	500 kcmil	
	(67mm²)	(253mm²)	(67mm²)	(253mm²)	
USMB/DE-C	350 kcmil	750 kcmil	350 kcmil	750 kcmil	
	(177mm²)	(380mm²)	(177mm²)	(380mm²)	
USMB5-C	500 kcmil	1000kcmil	500 kcmil	1000 kcmil	
	(253mm²)	(507mm²)	(253mm²)	(507mm²)	

The 'USMB' range of mechanical 'Y' connectors incorporate an integral moisture/contaminant block and utilise the patented universal range taking shear bolts. (USA Patent No's 6209424 & 6321624)

The appropriate socket is to be used at all times, typical examples shown below.




'JTS/9' 1/2" sq Driver





Mechanical 'Y' Connector with Moisture/Contaminant Block for Medium/High Voltage Applications

'USMB-C' & 'USMB5-C' Copper 'Y' Connector

Physical Dimensions:

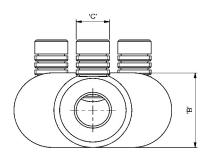

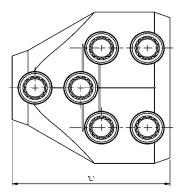

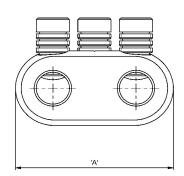

Connector Reference	Dimensions				
	'L'	'B'	'A'	,C,	
USMB/FPL-C	3" (76mm)	1.48" (37.5mm)	3" (76mm)	6 x M16	
USMB/FPL-2-C	3.50" (89mm)	1.48" (37.5mm)	3" (76mm)	6 x M16	
USMB/FPL-4-C	3.50" (89mm)	1.48" (37.5mm)	3" (76mm)	6 x M16	
USMB/DE-C	3.50" (89mm)	1.48" (37.5mm)	3" (76mm)	6 x M16	
USMB5-C	6.10" (155mm)	1.85" (47mm)	3.74" (95mm)	9 x M18	

Material: Copper (Electro-Tinned)

Test Specification: ANSI C119.4 Class 2 Partial Tension / IEEE 404

Test Report No: TTR/274 (Torque Resistance & Tensile)

Fitting instructions:

- 1. Strip insulation from each core equal to the depth of the bore.
- 2. Wire brush the exposed conductor cores and wipe clean (optional).
- 3. Align and position the conductor cores in each of the bores ensuring that the core is fully inserted to the centre wall.
- 4. Fit the universal shear screws within the connector and torque tighten one turn at a time, using the correct socket, until the bolts have sheared.